## CRITICAL ITEMS LIST (CIL)

SYSTEM:

ASI

ET Interface Hardware

FUNCTIONAL CRIT: PHASE(S):

1

SUBSYSTEM: REV & DATE: DCN & DATE:

J, 12-19-97

HAZARD REF:

b 5.11

ANALYSTS:

C. Rush/E. Howell

FAILURE MODE:

Structural Failure

FAILURE EFFECT:

Loss of mission and vehicle/crew due to collapse of interface system resulting in

fire/explosion or debris source to Orbiter.

TIME TO EFFECT:

Immediate

FAILURE CAUSE(S):

Improper Manufacture

Failure of Attaching Hardware

REDUNDANCY SCREENS:

Not Applicable

FUNCTIONAL DESCRIPTION: Provides aft support interface for LH Orbiter/ET attach.

FMEA 1TEM CODE(S)	PART NO.	PART NAME	QTY	EFFECTIVITY
4.5.17.1	80911071763-019	Ball Fitting Assembly (EO-2)	1	LWT-54 & Up

REMARKS:		
· ·		

#### CRITICAL ITEMS LIST (CIL) CONTINUATION SHEET

SYSTEM: SUBSYSTEM:

ET Interface Hardware

REV & DATE: DCN & DATE:

J. 12-19-97

FMEA ITEM CODE(S):

4.5.17.1

#### RATIONALE FOR RETENTION

#### DESIGN:

A, B: The fitting is machined from 7050-174 aluminum alloy forging. Materials selected for this part number are in accordance with MMC-ET-SE16 which assures repetitive conformance of composition and properties. Part integrity is assured by ultrasonic inspection per MIL-1-8950 and penetrant inspection per STP2501. The ball fitting and attachment hardware are designed to the required ultimate safety factor of 1.4 (ET Stress Report 826-2188).

B: Attaching hardware is selected from the Approved Standard Parts List (ASPL 826-3500), installed per STP2014 and torqued using values specified on Engineering drawings. Tensile installation loads are sufficient to provide screening for major flaws in individual fasteners.

#### TEST:

B:

The Ball Fitting Assy (EO-2) is certified. Reference HCS MMC-ET-TMO8-L-S114 (LWT-54 thru 88) and HCS MMC-ET-TM08-L-S516 (LWT-89 & Up).

#### Vendor:

Attaching fasteners are procured and tested to standard drawings 26L2 and 33L2.

## INSPECTION:

### Vendor Inspection - Lockheed Martin Surveillance:

A, B: Verify materials selection and verification controls (MMC-ET-SE16, STM5168, STM-Q-250, drawings 80911071771, 80911071773, and standard drawings 26L2 and 33L2).

A: Inspect cadmium plating on pins (80911071773).

A; Inspect dimensional conformance (80911071763 and 80911071773).

Penetrant inspect part (drawing 80911071773, 80911071763, and STP2501 Type 1 Method A and C). A:

A: Ultrasonic inspect part (80911071771).

### MAF Quality Inspection:

Inspect that attaching hardware is free from damage (drawing 80911071790 and STP2014). 8:

A, 8: Verify installation and witness torque (drawing 80911071790).

# Launch Site:

A: Inspect condition of ball fitting surface (OMRSD File II).

## FAILURE HISTORY:

Current data on test failures, unexplained anomalies and other failures experienced during ground processing activity can be found in the PRACA data base.